

Dunlop Super Tileset

Chemwatch Material Safety Data Sheet
Issue Date: 25-Jan-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 15-5658
Version No:2.1.1.1
Page 1 of 15

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

Dunlop Super Tileset

SYNONYMS

"cement based adhesive"

PRODUCT USE

Adhesive used to fix all ceramic tiles including mosaics and marble, rendered walls and concrete floors.

SUPPLIER

Company: Ardex Australia Pty Ltd

Address:

20 Powers Road

Seven Hills

NSW, 2147

Australia

Telephone: 1800 224 070

Emergency Tel: **1800 222 841**


Fax: +61 2 9838 7817

Section 2 - HAZARDS IDENTIFICATION

STATEMENT OF HAZARDOUS NATURE

HAZARDOUS SUBSTANCE. NON-DANGEROUS GOODS. According to the Criteria of NOHSC, and the ADG Code.

CHEMWATCH HAZARD RATINGS

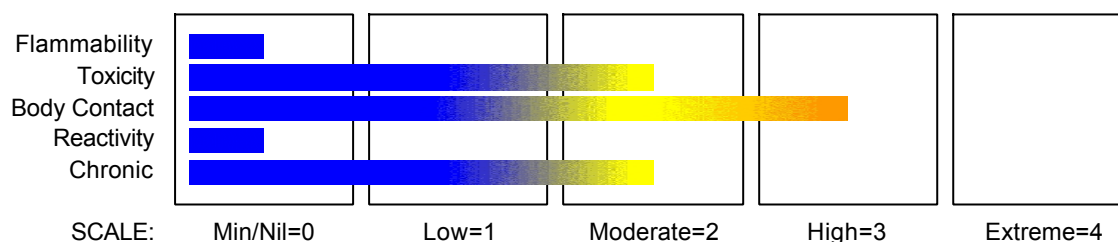

RISK

■ Causes burns.

SAFETY

• Keep locked up.

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 2 of 15

Section 2 - HAZARDS IDENTIFICATION

- Risk of serious damage to eyes.
 - Inhalation may produce health damage*.
 - Cumulative effects may result following exposure*.
 - Limited evidence of a carcinogenic effect*.
 - Possible respiratory and skin sensitiser*.
- * (limited evidence).
- Do not breathe dust.
 - Avoid contact with skin.
 - Avoid contact with eyes.
 - Wear suitable protective clothing.
 - Wear suitable gloves.
 - Wear eye/face protection.
 - Use only in well ventilated areas.
 - Keep container in a well ventilated place.
 - To clean the floor and all objects contaminated by this material, use water and detergent.
 - Take off immediately all contaminated clothing.
 - In case of contact with eyes, rinse with plenty of water and contact Doctor or Poisons Information Centre.
 - In case of accident or if you feel unwell IMMEDIATELY contact Doctor or Poisons Information Centre (show label if possible).
 - In case of accident by inhalation: remove casualty to fresh air and keep at rest.

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
portland cement	65997-15-1	10-60
graded sand	14808-60-7.	10-60
cellulosic thickener		0-1

Section 4 - FIRST AID MEASURES

SWALLOWED

- For advice, contact a Poisons Information Centre or a doctor at once.
- Urgent hospital treatment is likely to be needed.
- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
- Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
- Transport to hospital or doctor without delay.

EYE

- If this product comes in contact with the eyes:
 - Immediately hold eyelids apart and flush the eye continuously with running water.
 - Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 3 of 15

Section 4 - FIRST AID MEASURES

- Continue flushing until advised to stop by the Poisons Information Centre or a doctor, or for at least 15 minutes.
- Transport to hospital or doctor without delay.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

- If skin or hair contact occurs:
 - Immediately flush body and clothes with large amounts of water, using safety shower if available.
 - Quickly remove all contaminated clothing, including footwear.
 - Wash skin and hair with running water. Continue flushing with water until advised to stop by the Poisons Information Centre.
 - Transport to hospital, or doctor.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prosthesis such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor.
- If dust is inhaled, remove from contaminated area.
- Encourage patient to blow nose to ensure clear breathing passages.
- Ask patient to rinse mouth with water but to not drink water.
- Seek immediate medical attention.

NOTES TO PHYSICIAN

Treat symptomatically.

For acute or short-term repeated exposures to highly alkaline materials:

- Respiratory stress is uncommon but present occasionally because of soft tissue edema.
- Unless endotracheal intubation can be accomplished under direct vision, cricothyroidotomy or tracheotomy may be necessary.
- Oxygen is given as indicated.
- The presence of shock suggests perforation and mandates an intravenous line and fluid administration.
- Damage due to alkaline corrosives occurs by liquefaction necrosis whereby the saponification of fats and solubilisation of proteins allow deep penetration into the tissue.

Alkalis continue to cause damage after exposure.

INGESTION:

- Milk and water are the preferred diluents

No more than 2 glasses of water should be given to an adult.

- Neutralising agents should never be given since exothermic heat reaction may compound injury.

* Catharsis and emesis are absolutely contra-indicated.

* Activated charcoal does not absorb alkali.

* Gastric lavage should not be used.

Supportive care involves the following:

- Withhold oral feedings initially.
- If endoscopy confirms transmucosal injury start steroids only within the first 48 hours.
- Carefully evaluate the amount of tissue necrosis before assessing the need for surgical intervention.
- Patients should be instructed to seek medical attention whenever they develop difficulty in swallowing (dysphagia).

SKIN AND EYE:

- Injury should be irrigated for 20-30 minutes.

Eye injuries require saline. [Ellenhorn & Barceloux: Medical Toxicology].

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 4 of 15

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

- There is no restriction on the type of extinguisher which may be used.
- Use extinguishing media suitable for surrounding area.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves in the event of a fire.
- Prevent, by any means available, spillage from entering drains or water courses.
- Use fire fighting procedures suitable for surrounding area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

FIRE/EXPLOSION HAZARD

- Non combustible.
- Not considered a significant fire risk, however containers may burn.

Decomposition may produce toxic fumes of: metal oxides.

May emit poisonous fumes.

May emit corrosive fumes.

FIRE INCOMPATIBILITY

- None known.

HAZCHEM

None

Section 6 - ACCIDENTAL RELEASE MEASURES

MINOR SPILLS

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid contact with skin and eyes.
- Control personal contact with the substance, by using protective equipment.
- Use dry clean up procedures and avoid generating dust.
- Place in a suitable, labelled container for waste disposal.

MAJOR SPILLS

Moderate hazard.

- CAUTION: Advise personnel in area.
- Alert Emergency Services and tell them location and nature of hazard.
- Control personal contact by wearing protective clothing.
- Prevent, by any means available, spillage from entering drains or water courses.
- Recover product wherever possible.
- IF DRY: Use dry clean up procedures and avoid generating dust. Collect residues and place in sealed plastic bags or other containers for disposal. IF WET: Vacuum/shovel up and place in labelled containers for disposal.
- ALWAYS: Wash area down with large amounts of water and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise Emergency Services.

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 5 of 15

Section 6 - ACCIDENTAL RELEASE MEASURES

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- DO NOT allow material to contact humans, exposed food or food utensils.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storage and handling recommendations contained within this MSDS.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

SUITABLE CONTAINER

- Polyethylene or polypropylene container.
- Check all containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

- Avoid strong acids, acid chlorides, acid anhydrides and chloroformates.
- Avoid contact with copper, aluminium and their alloys.
- Metals and their oxides or salts may react violently with chlorine trifluoride and bromine trifluoride.
- These trifluorides are hypergolic oxidisers. They ignites on contact (without external source of heat or ignition) with recognised fuels - contact with these materials, following an ambient or slightly elevated temperature, is often violent and may produce ignition.
- The state of subdivision may affect the results.

STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry, well-ventilated area.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storage and handling recommendations contained within this MSDS.

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+: May be stored together

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 6 of 15

Section 7 - HANDLING AND STORAGE

O: May be stored together with specific preventions

X: Must not be stored together

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

Source	Material	TWA ppm	TWA mg/m ³	STEL ppm	STEL mg/m ³	Peak ppm	Peak mg/m ³	TWA F/CC	Notes
Australia Exposure Standards	portland cement (Portland cement (a))		10						(see Chapter 14)

The following materials had no OELs on our records

• graded sand:

CAS:14808- 60- 7

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m ³)	Revised IDLH Value (ppm)
portland cement 13763	5,000	
graded sand 85014	50	

MATERIAL DATA

DUNLOP SUPER TILESET:

PORTLAND CEMENT:

The concentration of dust, for application of respirable dust limits, is to be determined from the fraction that penetrates a separator whose size collection efficiency is described by a cumulative log-normal function with a median aerodynamic diameter of 4.0 µm (+-) 0.3 µm and with a geometric standard deviation of 1.5 µm (+-) 0.1 µm, i.e..generally less than 5 µm.

DUNLOP SUPER TILESET:

It is the goal of the ACGIH (and other Agencies) to recommend TLVs (or their equivalent) for all substances for which there is evidence of health effects at airborne concentrations encountered in the workplace.

At this time no TLV has been established, even though this material may produce adverse health effects (as evidenced in animal experiments or clinical experience). Airborne concentrations must be maintained as low as is practically possible and occupational exposure must be kept to a minimum.

NOTE: The ACGIH occupational exposure standard for Particles Not Otherwise Specified (P.N.O.S) does NOT apply.

Sensory irritants are chemicals that produce temporary and undesirable side-effects on the eyes, nose or throat. Historically occupational exposure standards for these irritants have been based on observation of workers' responses to various airborne concentrations. Present day expectations require that nearly every individual should be protected against even minor sensory irritation and exposure standards are established using uncertainty factors or safety factors of 5 to 10 or more. On occasion animal no-observable-effect-levels (NOEL) are used to determine these limits where human results are unavailable. An additional approach, typically used by the TLV committee (USA) in determining respiratory standards for this group of chemicals, has been to assign ceiling values (TLV C) to rapidly acting irritants and to assign short-term exposure limits (TLV STELs) when the weight of evidence from irritation, bioaccumulation and other endpoints combine to warrant such a limit. In contrast the MAK Commission (Germany) uses a five-category system based on intensive odour, local irritation, and elimination half-life. However this system is being replaced to be

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 7 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

consistent with the European Union (EU) Scientific Committee for Occupational Exposure Limits (SCOEL); this is more closely allied to that of the USA.

OSHA (USA) concluded that exposure to sensory irritants can:

- cause inflammation
- cause increased susceptibility to other irritants and infectious agents
- lead to permanent injury or dysfunction
- permit greater absorption of hazardous substances and
- acclimate the worker to the irritant warning properties of these substances thus increasing the risk of overexposure.

None assigned. Refer to individual constituents.

PORTLAND CEMENT:

for calcium silicate:

containing no asbestos and <1% crystalline silica

ES TWA: 10 mg/m³ inspirable dust

TLV TWA: 10 mg/m³ total dust (synthetic nonfibrous) A4

Although in vitro studies indicate that calcium silicate is more toxic than substances described as "nuisance dusts" is thought that adverse health effects which might occur following exposure to 10-20 mg/m³ are likely to be minimal. The TLV-TWA is thought to be protective against the physical risk of eye and upper respiratory tract irritation in workers and to prevent interference with vision and deposition of particulate in the eyes, ears, nose and mouth.

NOTE: This substance has been classified by the ACGIH as A4 NOT classifiable as causing Cancer in humans.

For calcium oxide:

The TLV-TWA is thought to be protective against undue irritation and is analogous to that recommended for sodium hydroxide.

For aluminium oxide:

The experimental and clinical data indicate that aluminium oxide acts as an "inert" material when inhaled and seems to have little effect on the lungs nor does it produce significant organic disease or toxic effects when exposures are kept under reasonable control.

[Documentation of the Threshold Limit Values], ACGIH, Sixth Edition.

for chrome(VI) containing substances:

Some jurisdictions require that health surveillance be carried on workers occupationally exposed to inorganic chromium. Such surveillance should emphasise

- demography, occupational and medical history and health advice
- physical examination with emphasis on the respiratory system and skin
- weekly skin inspection of hands and forearms by a "responsible person".

Portland cement is considered to be a nuisance dust that does not cause fibrosis and has little potential to induce adverse effects on the lung.

GRADED SAND:

These "dusts" have little adverse effect on the lungs and do not produce toxic effects or organic disease. Although there is no dust which does not evoke some cellular response at sufficiently high concentrations, the cellular response caused by P.N.O.C.s has the following characteristics:

- the architecture of the air spaces remain intact,
- scar tissue (collagen) is not synthesised to any degree,
- tissue reaction is potentially reversible.

Extensive concentrations of P.N.O.C.s may:

- seriously reduce visibility
- cause unpleasant deposits in the eyes, ears and nasal passages,
- contribute to skin or mucous membrane injury by chemical or mechanical action, per se, or by the rigorous skin cleansing procedures necessary for their removal. [ACGIH]

This limit does not apply:

- to brief exposures to higher concentrations
- nor does it apply to those substances that may cause physiological impairment at lower concentrations

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 8 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

but for which a TLV has as yet to be determined.

This exposure standard applies to particles which


- are insoluble or poorly soluble* in water or, preferably, in aqueous lung fluid (if data is available)

and

- have a low toxicity (i.e.. are not cytotoxic, genotoxic, or otherwise chemically reactive with lung tissue, and do not emit ionizing radiation, cause immune sensitization, or cause toxic effects other than by inflammation or by a mechanism of lung overload).

NOTE: This product contains negligible amount of respirable dust.

PERSONAL PROTECTION

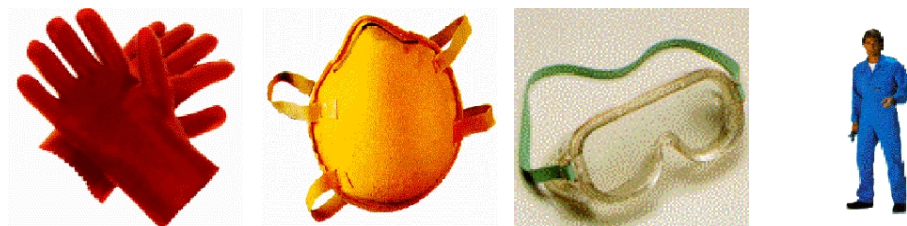

EYE

- Chemical goggles.
- Full face shield may be required for supplementary but never for primary protection of eyes
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59], [AS/NZS 1336 or national equivalent].

HANDS/FEET

■ NOTE:

- The material may produce skin sensitisation in predisposed individuals. Care must be taken, when removing gloves and other protective equipment, to avoid all possible skin contact.

- Contaminated leather items, such as shoes, belts and watch-bands should be removed and destroyed.

The selection of the suitable gloves does not only depend on the material, but also on further marks of quality which vary from manufacturer to manufacturer. Where the chemical is a preparation of several substances, the resistance of the glove material can not be calculated in advance and has therefore to be checked prior to the application.

The exact break through time for substances has to be obtained from the manufacturer of the protective gloves and

has to be observed when making a final choice.

Suitability and durability of glove type is dependent on usage. Important factors in the selection of gloves include:

- frequency and duration of contact,
- chemical resistance of glove material,
- glove thickness and
- dexterity

Select gloves tested to a relevant standard (e.g. Europe EN 374, US F739, AS/NZS 2161.1 or national equivalent).

- When prolonged or frequently repeated contact may occur, a glove with a protection class of 5 or higher

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 9 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

(breakthrough time greater than 240 minutes according to EN 374, AS/NZS 2161.10.1 or national equivalent) is recommended.

- When only brief contact is expected, a glove with a protection class of 3 or higher (breakthrough time greater than 60 minutes according to EN 374, AS/NZS 2161.10.1 or national equivalent) is recommended.
- Contaminated gloves should be replaced.

Gloves must only be worn on clean hands. After using gloves, hands should be washed and dried thoroughly.

Application of a non-perfumed moisturiser is recommended.

Experience indicates that the following polymers are suitable as glove materials for protection against undissolved, dry solids, where abrasive particles are not present.

- polychloroprene
- nitrile rubber
- butyl rubber
- fluorocautchouc
- polyvinyl chloride

Gloves should be examined for wear and/ or degradation constantly.

OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

RESPIRATOR

- Particulate. (AS/NZS 1716 & 1715, EN 143:2000 & 149:2001, ANSI Z88 or national equivalent)
- Respirators may be necessary when engineering and administrative controls do not adequately prevent exposures.
- The decision to use respiratory protection should be based on professional judgment that takes into account toxicity information, exposure measurement data, and frequency and likelihood of the worker's exposure - ensure users are not subject to high thermal loads which may result in heat stress or distress due to personal protective equipment (powered, positive flow, full face apparatus may be an option).
- Published occupational exposure limits, where they exist, will assist in determining the adequacy of the selected respiratory . These may be government mandated or vendor recommended.
- Certified respirators will be useful for protecting workers from inhalation of particulates when properly selected and fit tested as part of a complete respiratory protection program.
- Use approved positive flow mask if significant quantities of dust becomes airborne.
- Try to avoid creating dust conditions.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

■ Engineering controls are used to remove a hazard or place a barrier between the worker and the hazard. Well-designed engineering controls can be highly effective in protecting workers and will typically be independent of worker interactions to provide this high level of protection.

The basic types of engineering controls are:

Process controls which involve changing the way a job activity or process is done to reduce the risk.

Enclosure and/or isolation of emission source which keeps a selected hazard "physically" away from the worker and ventilation that strategically "adds" and "removes" air in the work environment. Ventilation can remove or dilute an air contaminant if designed properly. The design of a ventilation system must match the particular process and chemical or contaminant in use.

Employers may need to use multiple types of controls to prevent employee overexposure.

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 10 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

Local exhaust ventilation usually required. If risk of overexposure exists, wear approved respirator. Correct fit is essential to obtain adequate protection. Supplied-air type respirator may be required in special circumstances. Correct fit is essential to ensure adequate protection. An approved self contained breathing apparatus (SCBA) may be required in some situations. Provide adequate ventilation in warehouse or closed storage area.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Fine off-white powder; insoluble in water. Bulk density: 1.5 kg/dm³ (approximately).

PHYSICAL PROPERTIES

Does not mix with water.

Alkaline.

State	Divided Solid	Molecular Weight	Not Applicable
Melting Range (°C)	Not Available	Viscosity	Not Applicable
Boiling Range (°C)	Not Applicable	Solubility in water (g/L)	Immiscible
Flash Point (°C)	Not Applicable	pH (1% solution)	11 (paste form)
Decomposition Temp (°C)	Not Available	pH (as supplied)	Not Applicable
Autoignition Temp (°C)	Not Applicable	Vapour Pressure (kPa)	Not Applicable
Upper Explosive Limit (%)	Not Applicable	Specific Gravity (water=1)	Not Available
Lower Explosive Limit (%)	Not Applicable	Relative Vapour Density (air=1)	Not Applicable
Volatile Component (%vol)	Not Applicable	Evaporation Rate	Not Applicable

Section 10 - STABILITY AND REACTIVITY

CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

For incompatible materials - refer to Section 7 - Handling and Storage.

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

SWALLOWED

■ The material can produce chemical burns within the oral cavity and gastrointestinal tract following ingestion.

Not normally a hazard due to the physical form of product. The material is a physical irritant to the gastrointestinal tract.

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 11 of 15

Section 11 - TOXICOLOGICAL INFORMATION

EYE

■ The material can produce chemical burns to the eye following direct contact. Vapours or mists may be extremely irritating.

If applied to the eyes, this material causes severe eye damage.

SKIN

■ The material can produce chemical burns following direct contact with the skin.

Handling wet cement can cause dermatitis. Cement when wet is quite alkaline and this alkali action on the skin contributes strongly to cement contact dermatitis since it may cause drying and defatting of the skin which is followed by hardening, cracking, lesions developing, possible infections of lesions and penetration by soluble salts.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

INHALED

■ Inhalation of dusts, generated by the material during the course of normal handling, may be damaging to the health of the individual.

Persons with impaired respiratory function, airway diseases and conditions such as emphysema or chronic bronchitis, may incur further disability if excessive concentrations of particulate are inhaled.

If prior damage to the circulatory or nervous systems has occurred or if kidney damage has been sustained, proper screenings should be conducted on individuals who may be exposed to further risk if handling and use of the material result

in excessive exposures.

Effects on lungs are significantly enhanced in the presence of respirable particles.

CHRONIC HEALTH EFFECTS

■ Repeated or prolonged exposure to corrosives may result in the erosion of teeth, inflammatory and ulcerative changes in the mouth and necrosis (rarely) of the jaw. Bronchial irritation, with cough, and frequent attacks of bronchial pneumonia may ensue. Gastrointestinal disturbances may also occur. Chronic exposures may result in dermatitis and/or conjunctivitis.

Substance accumulation, in the human body, may occur and may cause some concern following repeated or long-term occupational exposure.

There is some evidence that inhaling this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

There is limited evidence that, skin contact with this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

Overexposure to respirable dust may cause coughing, wheezing, difficulty in breathing and impaired lung function. Chronic symptoms may include decreased vital lung capacity, chest infections

Repeated exposures, in an occupational setting, to high levels of fine-divided dusts may produce a condition known as pneumoconiosis which is the lodgement of any inhaled dusts in the lung irrespective of the effect.

This is particularly true when a significant number of particles less than 0.5 microns (1/50,000 inch), are present. Lung shadows are seen in the X-ray. Symptoms of pneumoconiosis may include a progressive dry cough, shortness of breath on exertion (exertional dyspnea), increased chest expansion, weakness and weight loss. As the disease progresses the cough produces a stringy mucous, vital capacity decreases further and shortness of breath becomes more severe. Other signs or symptoms include altered breath sounds, diminished lung capacity, diminished oxygen uptake during exercise, emphysema and pneumothorax (air in lung cavity) as a rare complication.

Removing workers from possibility of further exposure to dust generally leads to halting the progress of the lung abnormalities. Where worker-exposure potential is high, periodic examinations with emphasis on lung dysfunctions should be undertaken

Dust inhalation over an extended number of years may produce pneumoconiosis. Pneumoconiosis is the accumulation of dusts in the lungs and the tissue reaction in its presence. It is further classified as being of noncollagenous or collagenous types. Noncollagenous pneumoconiosis, the benign form, is identified by

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 12 of 15

Section 11 - TOXICOLOGICAL INFORMATION

minimal stromal reaction, consists mainly of reticulin fibres, an intact alveolar architecture and is potentially reversible.

Cement eczema may be due to chromium in feed stocks or contamination from materials of construction. Sensitisation to chromium may be the leading cause of nickel and cobalt sensitivity and the high alkalinity of cement is an important factor in cement dermatoses [ILO].

TOXICITY AND IRRITATION

■ unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

GRADED SAND:

PORTLAND CEMENT:

■ No significant acute toxicological data identified in literature search.

■ Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production.

PORTLAND CEMENT:

■ The following information refers to contact allergens as a group and may not be specific to this product. Contact allergies quickly manifest themselves as contact eczema, more rarely as urticaria or Quincke's oedema. The pathogenesis of contact eczema involves a cell-mediated (T lymphocytes) immune reaction of the delayed type. Other allergic skin reactions, e.g. contact urticaria, involve antibody-mediated immune reactions. The significance of the contact allergen is not simply determined by its sensitisation potential: the distribution of the substance and the opportunities for contact with it are equally important. A weakly sensitising substance which is widely distributed can be a more important allergen than one with stronger sensitising potential with which few individuals come into contact. From a clinical point of view, substances are noteworthy if they produce an allergic test reaction in more than 1% of the persons tested.

CARCINOGEN

graded sand

International
Agency for
Research on Cancer
(IARC) - Agents
Reviewed by the
IARC Monographs

Group

1

Carcinogenic to
humans

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 13 of 15

Section 12 - ECOLOGICAL INFORMATION

PORTLAND CEMENT:

Marine Pollutant Yes

Do NOT allow product to come in contact with surface waters or to intertidal areas below the mean high water mark. Do not contaminate water when cleaning equipment or disposing of equipment wash-waters.

Wastes resulting from use of the product must be disposed of on site or at approved waste sites.

For Metal:

Atmospheric Fate - Metal-containing inorganic substances generally have negligible vapour pressure and are not expected to partition to air.

Environmental Fate: Environmental processes, such as oxidation, the presence of acids or bases and microbiological processes, may transform insoluble metals to more soluble ionic forms. Environmental processes may enhance bioavailability and may also be important in changing solubilities.

Aquatic/Terrestrial Fate: When released to dry soil, most metals will exhibit limited mobility and remain in the upper layer; some will leach locally into ground water and/ or surface water ecosystems when soaked by rain or melt ice. A metal ion is considered infinitely persistent because it cannot degrade further. Once released to surface waters and moist soils their fate depends on solubility and dissociation in water. A significant proportion of dissolved/ sorbed metals will end up in sediments through the settling of suspended particles. The remaining metal ions can then be taken up by aquatic organisms. Ionic species may bind to dissolved ligands or sorb to solid particles in water.

Ecotoxicity: Even though many metals show few toxic effects at physiological pH levels, transformation may introduce new or magnified effects.

DO NOT discharge into sewer or waterways.

Ecotoxicity

Ingredient	Persistence: Water/Soil	Persistence: Air	Bioaccumulation	Mobility
portland cement	No Data Available	No Data Available	No Data Available	No Data Available
graded sand	No Data Available	No Data Available	No Data Available	No Data Available

Section 13 - DISPOSAL CONSIDERATIONS

Legislation addressing waste disposal requirements may differ by country, state and/ or territory. Each user must refer to laws operating in their area. In some areas, certain wastes must be tracked.

A Hierarchy of Controls seems to be common - the user should investigate:

- Reduction
- Reuse
- Recycling
- Disposal (if all else fails)

This material may be recycled if unused, or if it has not been contaminated so as to make it unsuitable for its intended use. Shelf life considerations should also be applied in making decisions of this type. Note that properties of a material may change in use, and recycling or reuse may not always be appropriate. In most instances the supplier of the material should be consulted.

- DO NOT allow wash water from cleaning or process equipment to enter drains.
- It may be necessary to collect all wash water for treatment before disposal.
- In all cases disposal to sewer may be subject to local laws and regulations and these should be considered first.
- Where in doubt contact the responsible authority.
- Recycle wherever possible or consult manufacturer for recycling options.

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 14 of 15

Section 13 - DISPOSAL CONSIDERATIONS

- Consult State Land Waste Management Authority for disposal.
- Bury residue in an authorised landfill.
- Recycle containers if possible, or dispose of in an authorised landfill.

Section 14 - TRANSPORTATION INFORMATION

HAZCHEM:

None (ADG7)

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS: ADG7, IATA, IMDG

Section 15 - REGULATORY INFORMATION

Indications of Danger:

C Corrosive

POISONS SCHEDULE

None

REGULATIONS

Regulations for ingredients

portland cement (CAS: 65997-15-1) is found on the following regulatory lists;

"Australia Exposure Standards", "Australia High Volume Industrial Chemical List (HVICL)", "Australia Inventory of Chemical Substances (AICS)", "OECD List of High Production Volume (HPV) Chemicals"

graded sand (CAS: 14808-60-7) is found on the following regulatory lists;

"Australia - New South Wales - Work Health and Safety Regulation 2011 - Requirements for health monitoring - Hazardous chemicals (other than lead) requiring health monitoring", "Australia - New South Wales - Work Health and Safety Regulation 2011 Restricted hazardous chemicals", "Australia - New South Wales Hazardous Substances Prohibited for Specific Uses", "Australia - New South Wales Hazardous Substances Requiring Health Surveillance", "Australia - Northern Territories Work Health and Safety National Uniform Legislation Regulations- Requirements for health monitoring - Hazardous chemicals (other than lead) requiring health monitoring", "Australia - Queensland Work Health and Safety Regulation - Hazardous chemicals (other than lead) requiring health monitoring", "Australia - Queensland Work Health and Safety Regulation - Restricted hazardous chemicals", "Australia - South Australia - Hazardous Substances Requiring Health Surveillance", "Australia - South Australia - Work Health and Safety Regulations 2012 - Requirements for health monitoring - Hazardous chemicals (other than lead) requiring health monitoring", "Australia - South Australia - Work Health and Safety Regulations 2012 - Restricted hazardous chemicals", "Australia - Tasmania Hazardous Substances Prohibited for Specified Uses", "Australia - Tasmania Hazardous Substances Requiring Health Surveillance", "Australia - Western Australia Hazardous Substances Prohibited for Specified Uses or Methods of Handling", "Australia - Western Australia Hazardous Substances Requiring Health Surveillance", "Australia Hazardous Substances", "Australia Hazardous Substances Requiring Health Surveillance", "Australia High Volume Industrial Chemical List (HVICL)", "Australia Inventory of Chemical Substances (AICS)", "Australia Occupational Health and Safety (Commonwealth Employment) (National Standards) Regulations 1994 - Hazardous Substances Requiring Health Surveillance", "Australia Work Health and Safety Regulations 2011 - Hazardous chemicals (other than lead) requiring health monitoring", "Australia Work Health and Safety Regulations 2011 -

continued...

Dunlop Super Tileset

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 25-Jan-2013

A317LP

CHEMWATCH 15-5658

Version No:2.1.1.1

Page 15 of 15

Section 15 - REGULATORY INFORMATION

Restricted hazardous chemicals", "FisherTransport Information", "International Agency for Research on Cancer (IARC) - Agents Reviewed by the IARC Monographs", "International Fragrance Association (IFRA) Survey: Transparency List", "OECD List of High Production Volume (HPV) Chemicals", "Sigma-AldrichTransport Information", "United Nations Consolidated List of Products Whose Consumption and/or Sale Have Been Banned, Withdrawn, Severely Restricted or Not Approved by Governments"

No data for Dunlop Super Tileset (CW: 15-5658)

Section 16 - OTHER INFORMATION

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

www.chemwatch.net/references.

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 25-Jan-2013

Print Date: 5-Jun-2013

This is the end of the MSDS.